

# Firmware Release Note

<b>Model : SL-C410W</b>	<b>Date :</b>	<b>January 5, 2016</b>
-------------------------	---------------	------------------------

Version	Category	Change Description
<b>V3.00.02.06</b> (7-Apr, 2014)	Fix Defect	Fixed the problem that Android 4.3 (JB) mobile device can't connect when wifi direct connection was max.
		Fixed NFC connection problem.
<b>V3.00.02.07</b> (15-Apr, 2014)	Fix Defect	Improvement of Color to Mono Printing Problem
		Changed the target temperautre for improvement of Naonodust
<b>V3.00.02.07</b> <b>_0401040_1.01</b> (22-May, 2014)	Fix Defect	Fixed Google Cloud Print issue. ("chunked" data control)
<b>V3.00.02.16</b> (22-Dec, 2014)	Fix Defect	Compatibility of OTG cable
		Fix initialization issue of user setting vlaues when f/w is upgraded
		[Google Cloud Print] Fix to the latent issue and enhancement to UI
		Fix USB PC printing blocking problem
		[Google Cloud Print] Error page is getting printed when given JPEG/TXT print job.
<b>V3.00.02.19</b> (25-Sep, 2015)	Add Func.	Apply to Samsung Cloud Print
		Apply the new font in PCL5, PCL 6
	Fix Defect	[Google Cloud Print] Print & deregistration doesn't work properly
<b>V3.00.02.20</b> (4-Jan, 2016)	Fix Defect	Fixed the print quality(pollution) issue

## ※ Note

- Please do not turn off the printer and your computer until firmware update finishes.
  - If you are using USB connection, disconnect all other USB printers from the PC.
  - The firmware update you are about to install has been tested for compatibility with Samsung toner cartridge products ONLY.
- Installing The upgrade may cause a non-Samsung toner cartridge to malfunction.
- Do not run your printer during the firmware update.(Do not have any print job)

## Update Procedure

1. Make sure that the machine is connected to the PC with a USB cable or network
2. Make sure that the current f/w version of your printer.

Press and hold 'Cancel' button for about 2seconds until the green LED blinks slowly, and then release it

Configuration Report will be printed out, Check the f/w version.



If the firmware version is V3.xx.01.xx, Execute C41xW\_Upgrade\_Patch.exe

And then patch rom will be download on the machine.


Please wait until green LED is ON.(About 2 minute)

\* LED Status

- 2.1) Red LED Blinking for about 30 sec
- 2.2) Green LED ON for 30 sec
- 2.3) Red LED Blinking for 60 sec
- 2.4) Green LED ON

If the firmware version is V3.xx.02.00 and more higher, Go on No.3 Step.

3. Drag a f/w file(C410W\_V3.00.02.20.hd) and Drop down it on usblist2.exe

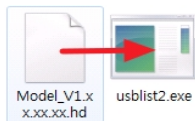

4. The firmware update will start.

Once the firmware update is complete, the machine will be rebooted automatically.